

Noises from area of firewall/instrument panel in S/W 204

Topic number LI62.25-P-056363
 Version 1
 Design group 62.25 Fire wall
 Date 06-07-2013
 Validity Affected vehicles
 S/W from VIN 204 G109570 to 204 G124323

Reason for change


Complaint:

Noises from area of firewall/instrument panel.

Cause:

The left front X-strut from the strut tower to the firewall may be touching the PVC seam and causing noises.

File	Designation
Schadensbereich.jpg	Firewall under windsheild

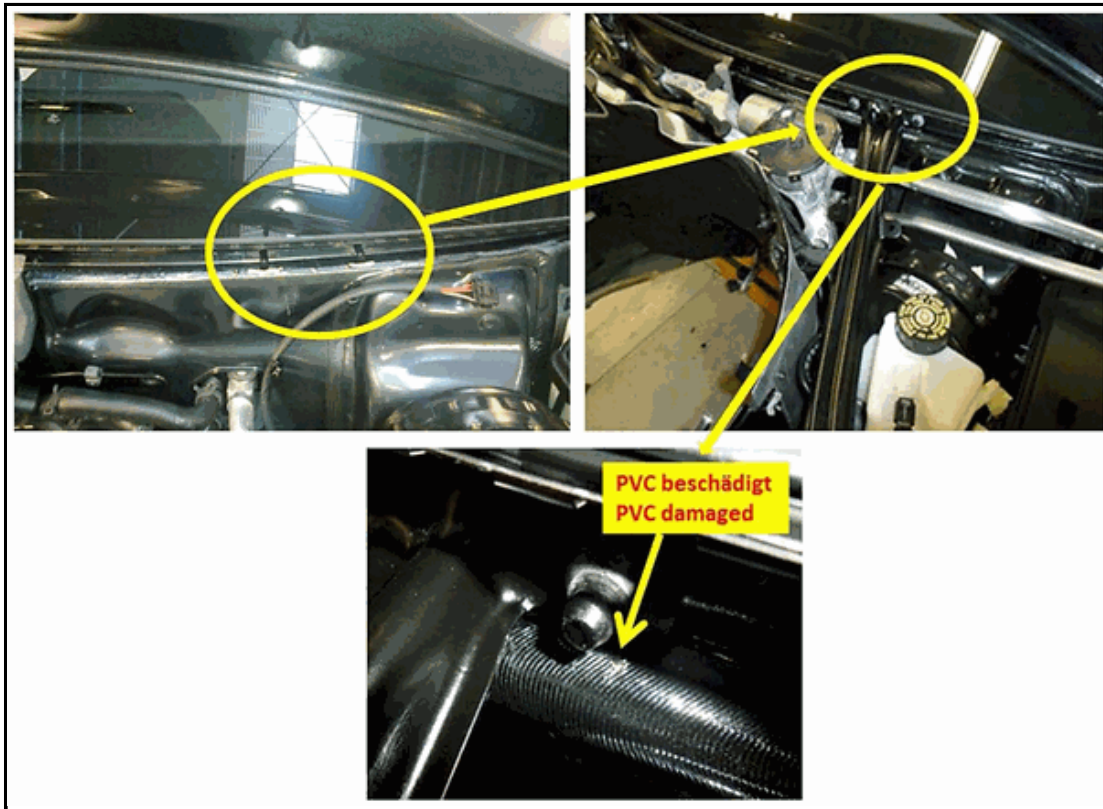

Attachments

Remedy:

- Remove cover of windshield wiper linkage under windshield.
- Detach X-strut.
- Rework PVC seam, if necessary bending the two flat bolts upwards slightly.
- Then restore the corrosion protection per WIS.



Body / Body/Cab / Body noises / Ripping noise
Body / Body/Cab / Body noises / Cracking/creaking
Body / Body/Cab / Body noises / Whirring
Body / Body/Cab / Body noises / Clattering
Body / Body/Cab / Body noises / Vibration noise
Body / Interior equipment / Instrument panel / Noise

Symptoms

Op. no.	Operation text	Time	Damage code	Note
			62A18 36	Firewall noise

Work units

© 2017 ALLDATA, LLC. All Rights Reserved. (Version 2.0.13872)